Stockton Services
PO Box 1306
Hampton, NH 03843-1306

Test Pit Report

Date: June 4, 2007

Owner: Eleanor Vogt

Locus: 65 Clark Road, Rye, NH

Present:

Anne W. Bialobrzeski Designer #348
Mike Oiler (MCO Excavators)
Dennis Plante (Town of Rye)
Eleanor Vogt (owner) Marc Vogt (occupant)

Test Pit Location: immediately adjacent to leach field on street side.

Test Pit Data:

0 –4”	loam and root mat, granular friable
6 -40”	10YR4/6 gravelly fine sandy loam, granular friable
40-42”	original topsoil and old root mat
42-70”	10yr3/6 fine sandy loam, granular friable
70-80”	2.5y5/4 fine sandy loam, friable when removed, possibly restrictive in place

Possible SHWT @ 70” (assumed, not confirmed), no observed water, no refusal

Estimated bottom of existing stone bed @ 36”, Test Pit elevation approx 3’ lower than exis grade at leach field, e.g. SHWT determined to be at least 70” below bed bottom. No streams, lakes, ponds, or tidal waters within 75’ of existing system. No wells within 75’.

OK TO REPLACE IN KIND.

Anne W. Bialobrzeski
Designer #348

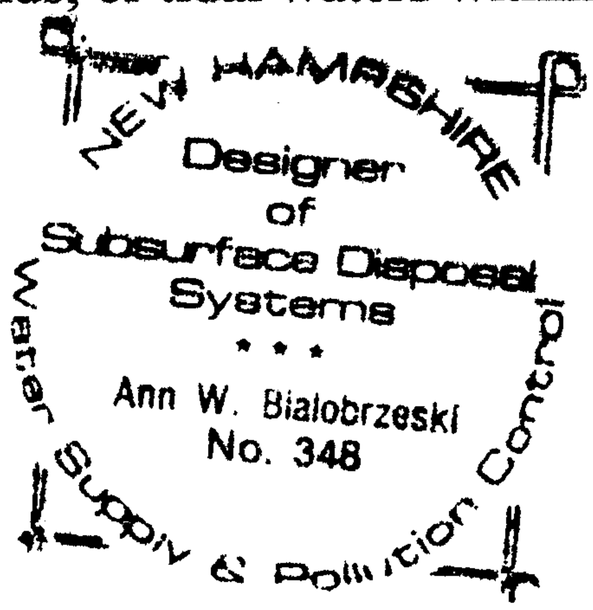

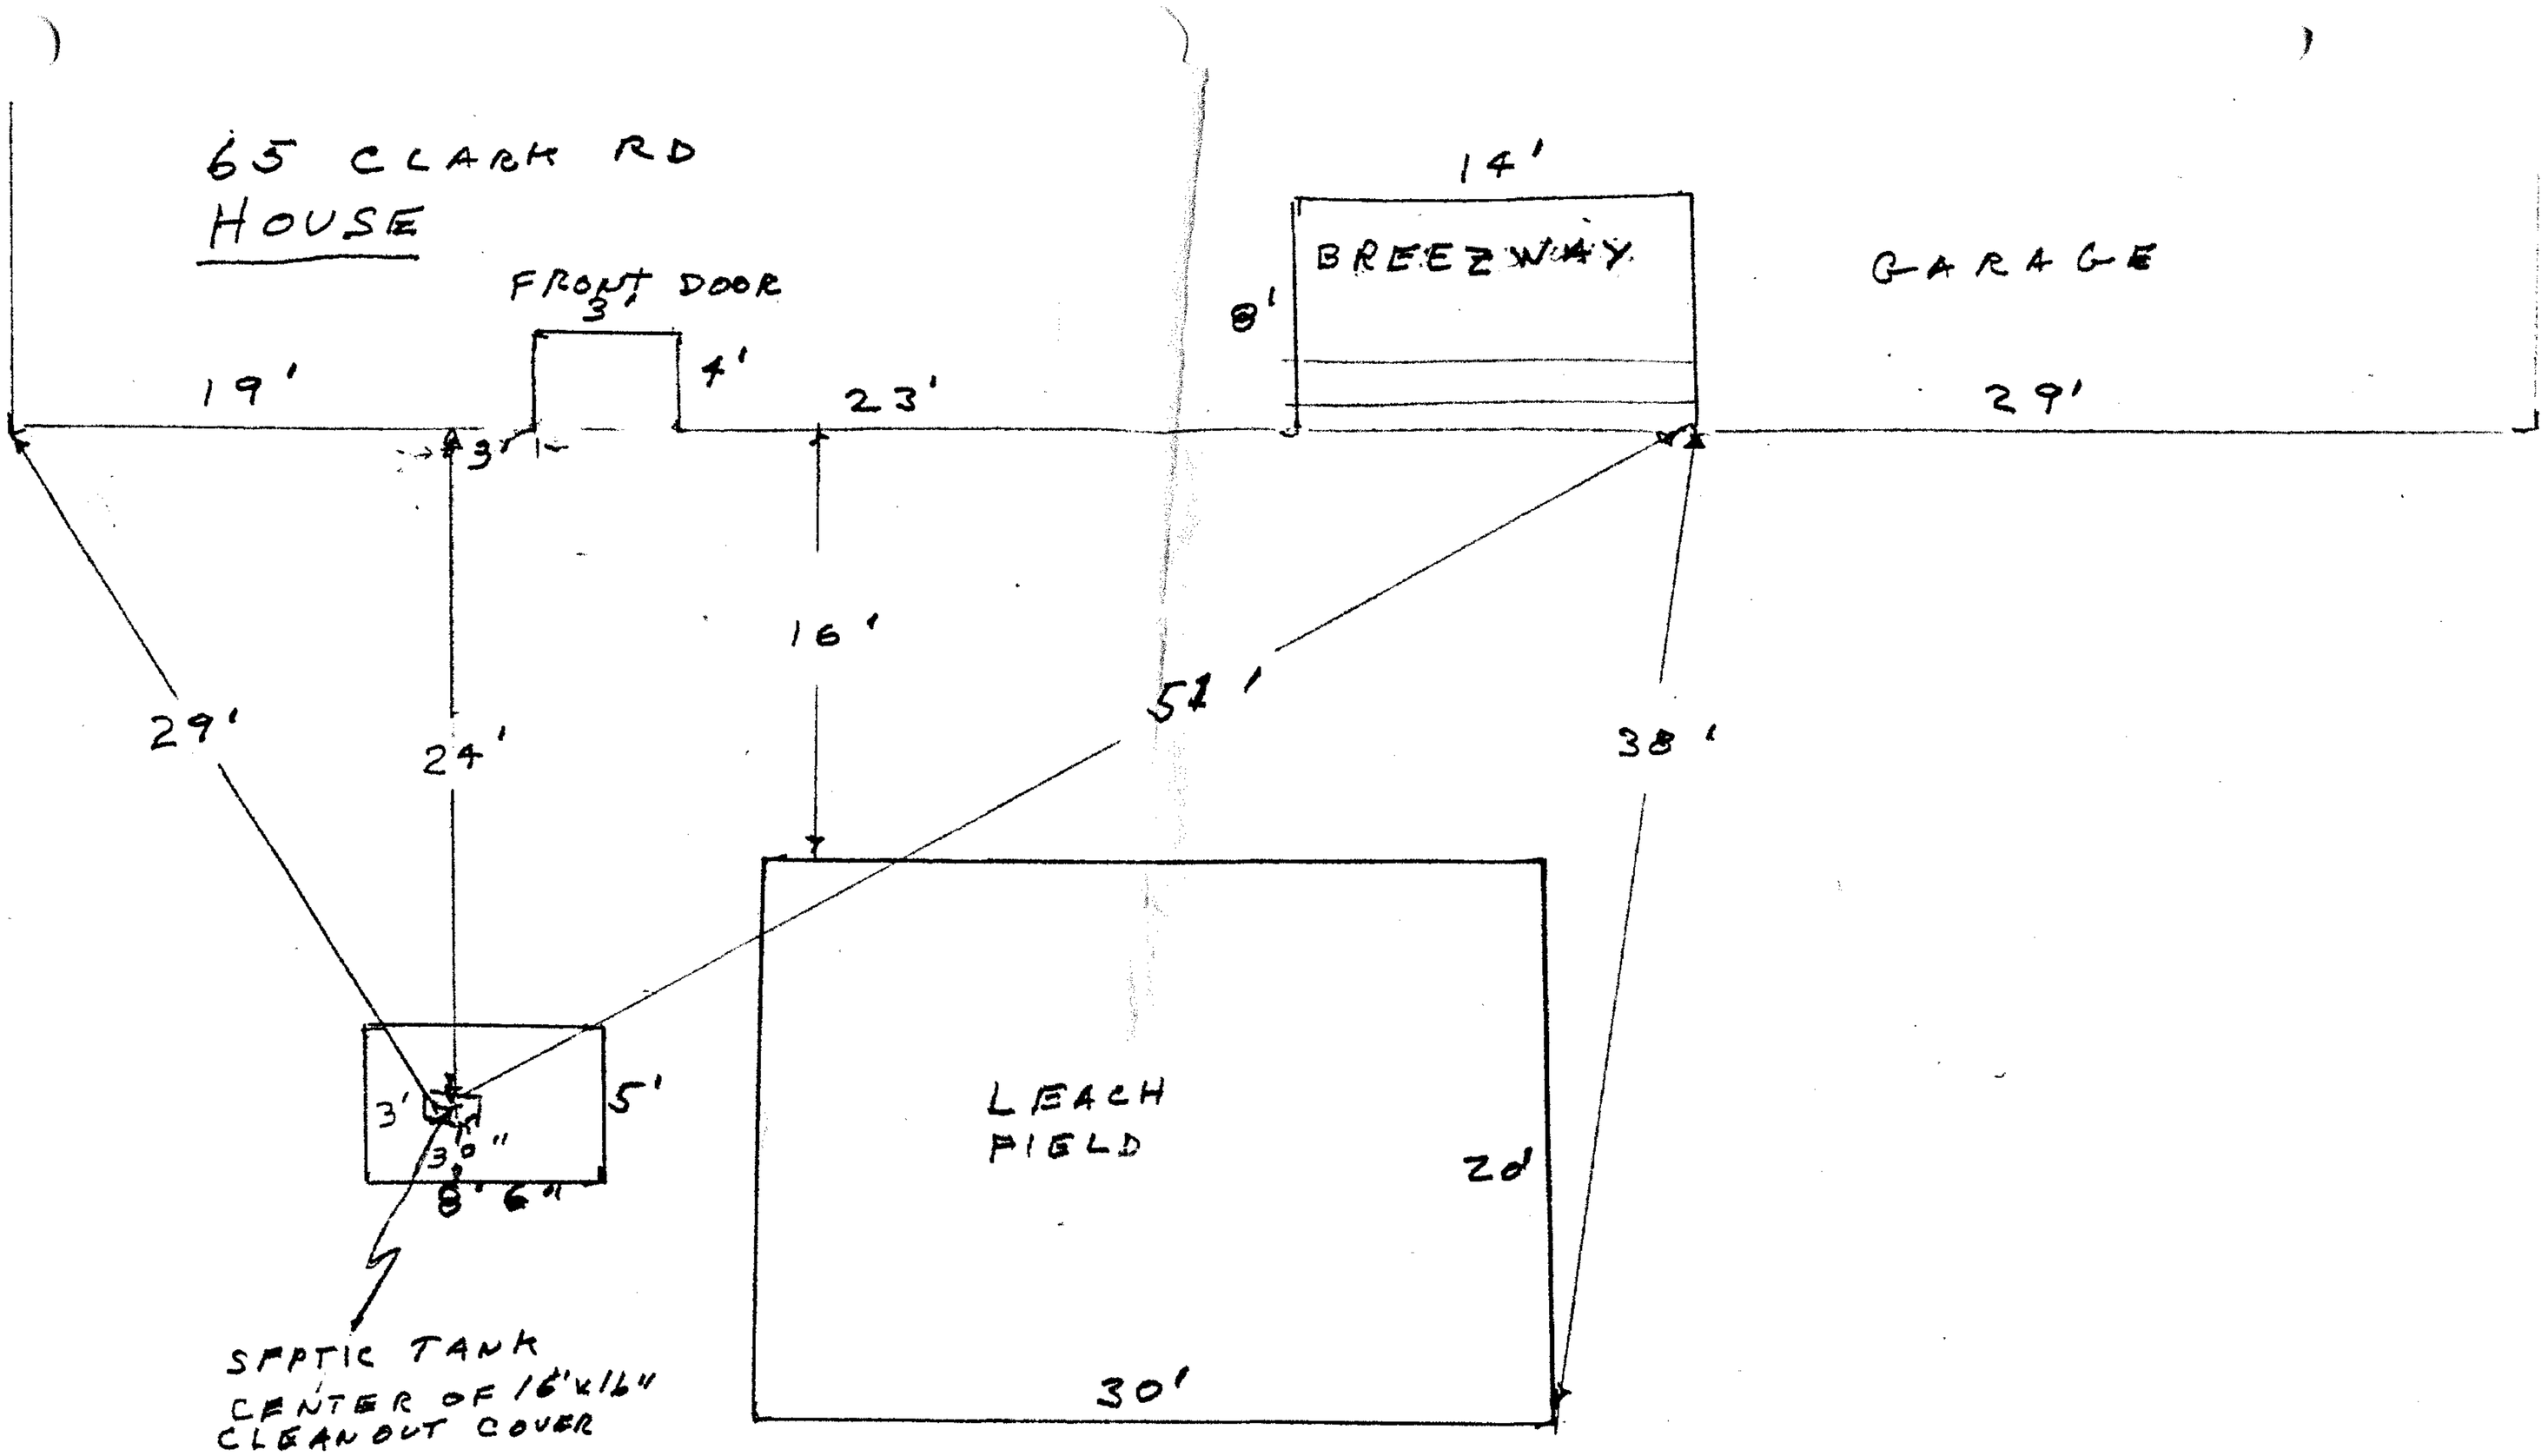

Sketch of
exis system
provided by
owner

TEST PIT
6/4/07